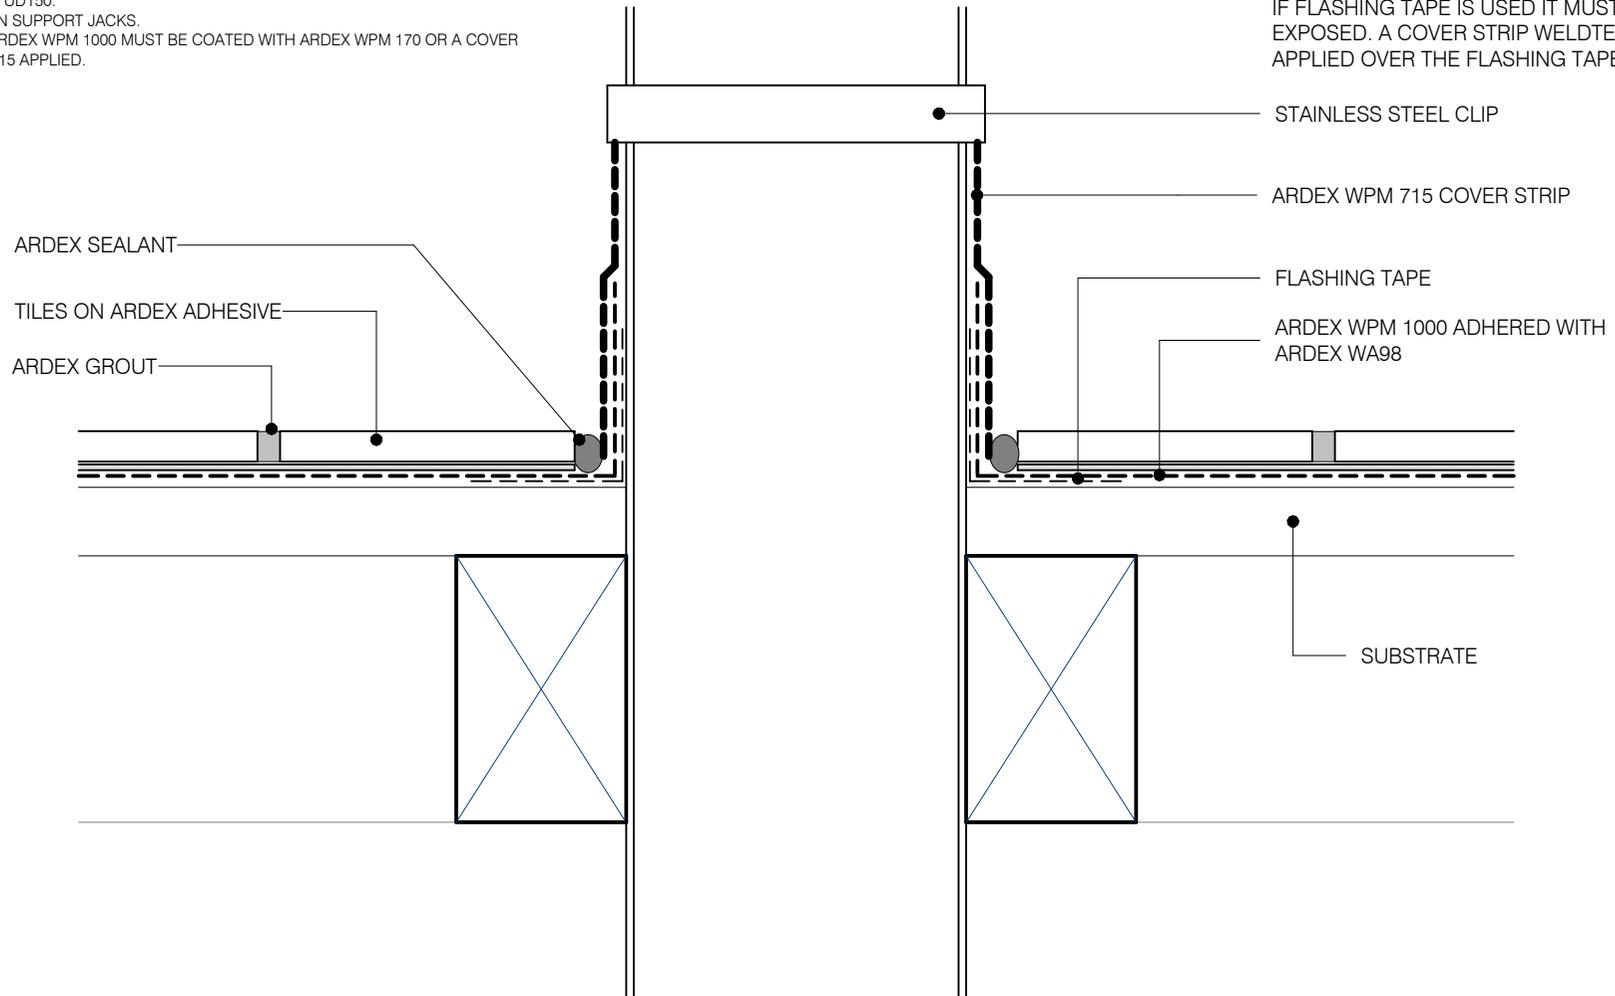NOTE:
WPM 1000 MUST NOT BE LEFT EXPOSED.
SUITABLE OVERLAYING SYSTEMS INCLUDE.
TILES DIRECTLY BONDED.
TILES ON ARDEX UD150.
TILES/PAVERS ON SUPPORT JACKS.
ANY EXPOSED ARDEX WPM 1000 MUST BE COATED WITH ARDEX WPM 170 OR A COVER
STRIP OF WPM 715 APPLIED.

NOTE:
IF FLASHING TAPE IS USED IT MUST NOT BE LEFT
EXPOSED. A COVER STRIP WELDTEC MUST BE
APPLIED OVER THE FLASHING TAPE TO FINISH

STAINLESS STEEL CLIP

ARDEX WPM 715 COVER STRIP

ARDEX SEALANT

FLASHING TAPE

TILES ON ARDEX ADHESIVE

ARDEX WPM 1000 ADHERED WITH
ARDEX WA98

ARDEX GROUT

SUBSTRATE

ARDEX WPM 1000

PIPE PENETRATION
SHEET TITLE

DWG NO. WT-12

DATE 13/07/2022

SCALE 1 : 2 @ A4