

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 1 of 15

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME

Ardex WPM 256 - Part A

SYNONYMS

"water based polyamide", "curing agent", "Shelter HydrEpoxy 256 - Part A"

PRODUCT USE

■ Requires that the two parts be mixed by hand or mixer before use, in accordance with manufacturers directions. Mix only as much as is required. Do not return the mixed material to the original containers. Part A of a two component water-based epoxy system used for sealing porous substrates and as an admixture with cement-based mortars.

SUPPLIER

Company: Ardex Australia Pty Ltd

Address:

20 Powers Road

Seven Hills

NSW, 2147

Australia

Telephone: 1800 224 070

Emergency Tel:1800 224 070 (Mon- Fri, 9am- 5pm)


Fax: +61 2 9838 7817

Section 2 - HAZARDS IDENTIFICATION

STATEMENT OF HAZARDOUS NATURE

HAZARDOUS SUBSTANCE. NON-DANGEROUS GOODS. According to NOHSC Criteria, and ADG Code.

CHEMWATCH HAZARD RATINGS

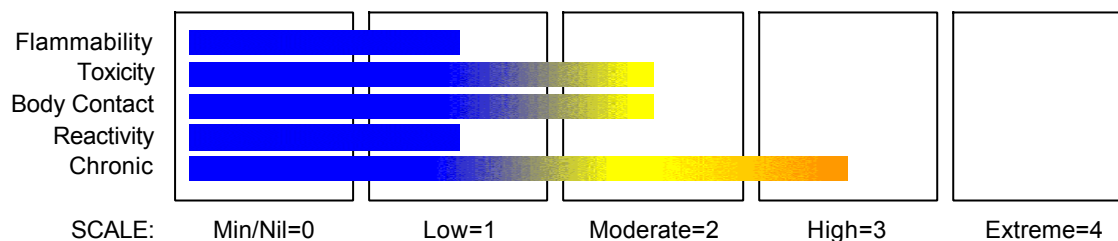

continued...

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 2 of 15

Section 2 - HAZARDS IDENTIFICATION

RISK

- May cause SENSITISATION by skin contact.

SAFETY

- Do not breathe gas/ fumes/ vapour/ spray.
- Use only in well ventilated areas.
- Keep container in a well ventilated place.
- Avoid exposure - obtain special instructions before use.
- To clean the floor and all objects contaminated by this material, use water and detergent.
- Keep container tightly closed.
- In case of contact with eyes, rinse with plenty of water and contact Doctor or Poisons Information Centre.
- If swallowed, IMMEDIATELY contact Doctor or Poisons Information Centre (show this container or label).

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
polyamide resin	Not avail.	10-30
triethylenetetramine	112-24-3	1-2
ingredients determined not to be hazardous		>60

Section 4 - FIRST AID MEASURES

SWALLOWED

- Immediately give a glass of water.
- First aid is not generally required. If in doubt, contact a Poisons Information Centre or a doctor.

EYE

- If this product comes in contact with the eyes:
- Wash out immediately with fresh running water.
- Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
- Seek medical attention without delay; if pain persists or recurs seek medical attention.
- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

- If skin contact occurs:
- Immediately remove all contaminated clothing, including footwear.
- Flush skin and hair with running water (and soap if available).
- Seek medical attention in event of irritation.

INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor, without delay.

continued...

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 3 of 15

Section 4 - FIRST AID MEASURES

NOTES TO PHYSICIAN

- Treat symptomatically.

Section 5 - FIRE FIGHTING MEASURES

EXTINGUISHING MEDIA

- Foam.
- Dry chemical powder.
- BCF (where regulations permit).
- Carbon dioxide.
- Water spray or fog - Large fires only.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- Wear full body protective clothing with breathing apparatus.
- Prevent, by any means available, spillage from entering drains or water course.
- Use water delivered as a fine spray to control fire and cool adjacent area.
- Avoid spraying water onto liquid pools.
- DO NOT approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.

FIRE/EXPLOSION HAZARD

- Combustible.
- Slight fire hazard when exposed to heat or flame.
- Heating may cause expansion or decomposition leading to violent rupture of containers.
- On combustion, may emit toxic fumes of carbon monoxide (CO).
- May emit acrid smoke.
- Mists containing combustible materials may be explosive.

Combustion products include:.

carbon dioxide (CO₂).

nitrogen oxides (NO_x).

other pyrolysis products typical of burning organic material.

May emit poisonous fumes.

May emit corrosive fumes.

FIRE INCOMPATIBILITY

- Avoid contamination with oxidising agents i.e. nitrates, oxidising acids, chlorine bleaches, pool chlorine etc. as ignition may result.

HAZCHEM

None

Personal Protective Equipment

Breathing apparatus.

Gas tight chemical resistant suit.

Limit exposure duration to 1 BA set 30 mins.

continued...

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 4 of 15

Section 6 - ACCIDENTAL RELEASE MEASURES

MINOR SPILLS

- Remove all ignition sources.
- Clean up all spills immediately.
- Avoid breathing vapours and contact with skin and eyes.
- Control personal contact by using protective equipment.
- Contain and absorb spill with sand, earth, inert material or vermiculite.
- Wipe up.
- Place in a suitable, labelled container for waste disposal.

MAJOR SPILLS

- Moderate hazard.
- Clear area of personnel and move upwind.
- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves.
- Prevent, by any means available, spillage from entering drains or water course.
- No smoking, naked lights or ignition sources.
- Increase ventilation.
- Stop leak if safe to do so.
- Contain spill with sand, earth or vermiculite.
- Collect recoverable product into labelled containers for recycling.
- Absorb remaining product with sand, earth or vermiculite.
- Collect solid residues and seal in labelled drums for disposal.
- Wash area and prevent runoff into drains.
- If contamination of drains or waterways occurs, advise emergency services.

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

Section 7 - HANDLING AND STORAGE

PROCEDURE FOR HANDLING

- DO NOT allow clothing wet with material to stay in contact with skin.
- DO NOT use aluminium, galvanised or tin-plated containers.
- DO NOT USE brass or copper containers / stirrers.
- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.
- Avoid smoking, naked lights or ignition sources.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately.
- Use good occupational work practice.
- Observe manufacturer's storing and handling recommendations.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working

continued...

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 5 of 15

Section 7 - HANDLING AND STORAGE

conditions.

SUITABLE CONTAINER

- Metal can or drum
- Packaging as recommended by manufacturer.
- Check all containers are clearly labelled and free from leaks.

STORAGE INCOMPATIBILITY

- Avoid reaction with oxidising agents.

STORAGE REQUIREMENTS

- Store in original containers.
- Keep containers securely sealed.
- No smoking, naked lights or ignition sources.
- Store in a cool, dry, well-ventilated area.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations.

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS



+



X



+



X



X



+

+: May be stored together

O: May be stored together with specific preventions

X: Must not be stored together

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

EXPOSURE CONTROLS

The following materials had no OELs on our records

- triethylenetetramine:

CAS:112- 24- 3

MATERIAL DATA

ARDEX WPM 256 - PART A:

Not available

POLYAMIDE RESIN:

- No exposure limits set by NOHSC or ACGIH.

TRIETHYLENETETRAMINE:

■ Sensory irritants are chemicals that produce temporary and undesirable side-effects on the eyes, nose or throat. Historically occupational exposure standards for these irritants have been based on observation of workers' responses to various airborne concentrations. Present day expectations require that nearly every individual should be protected against even minor sensory irritation and exposure standards are established using uncertainty factors or safety factors of 5 to 10 or more. On occasion animal no-observable-effect-levels (NOEL) are used to determine these limits where human results are unavailable. An additional approach, typically used by the TLV committee (USA) in determining respiratory standards for this group of chemicals,

continued...

Ardex WPM 256 - Part A

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 6 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

has been to assign ceiling values (TLV C) to rapidly acting irritants and to assign short-term exposure limits (TLV STELs) when the weight of evidence from irritation, bioaccumulation and other endpoints combine to warrant such a limit. In contrast the MAK Commission (Germany) uses a five-category system based on intensive odour, local irritation, and elimination half-life. However this system is being replaced to be consistent with the European Union (EU) Scientific Committee for Occupational Exposure Limits (SCOEL); this is more closely allied to that of the USA.

OSHA (USA) concluded that exposure to sensory irritants can:

- cause inflammation
- cause increased susceptibility to other irritants and infectious agents
- lead to permanent injury or dysfunction
- permit greater absorption of hazardous substances and
- acclimate the worker to the irritant warning properties of these substances thus increasing the risk of overexposure.

CEL TWA: 1 ppm, 6 mg/m³; STEL: 2 ppm, 12 mg/m³

[compare OEL TWA (Sweden): 1 ppm, 6 mg/m³; STEL: 2 ppm, 12 mg/m³ Sensitiser]

PERSONAL PROTECTION



EYE

- Safety glasses with side shields.
- Chemical goggles.
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59].

HANDS/FEET

- When handling liquid-grade epoxy resins wear chemically protective gloves (e.g nitrile or nitrile-butadiene rubber), boots and aprons.
- DO NOT use cotton or leather (which absorb and concentrate the resin), polyvinyl chloride, rubber or polyethylene gloves (which absorb the resin).
- DO NOT use barrier creams containing emulsified fats and oils as these may absorb the resin; silicone-based barrier creams should be reviewed prior to use.
- Wear chemical protective gloves, eg. PVC.
- Wear safety footwear or safety gumboots, eg. Rubber.

NOTE:

- The material may produce skin sensitisation in predisposed individuals. Care must be taken, when removing gloves and other protective equipment, to avoid all possible skin contact.
- Contaminated leather items, such as shoes, belts and watch-bands should be removed and destroyed.

continued...

Ardex WPM 256 - Part A

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 7 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

OTHER

- Overalls.
- P.V.C. apron.
- Barrier cream.
- Skin cleansing cream.
- Eye wash unit.

RESPIRATOR

■ Respiratory protection is required when ANY "Worst Case" vapour-phase concentration is exceeded (see Computer Prediction in "Exposure Standards").

Protection Factor (Min)	Half- Face Respirator	Full- Face Respirator
10 x ES	AK- P- - AUS AK- P- - PAPR- AUS	- -
50 x ES	- -	AK- P- - AUS AK- P- - PAPR- AUS
100 x ES	- -	AK- P- - 2 AK- P- - PAPR- 2

^ - Full-face.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

ENGINEERING CONTROLS

■ Local exhaust ventilation usually required. If risk of overexposure exists, wear approved respirator. Correct fit is essential to obtain adequate protection. Supplied-air type respirator may be required in special circumstances. Correct fit is essential to ensure adequate protection. An approved self contained breathing apparatus (SCBA) may be required in some situations. Provide adequate ventilation in warehouse or closed storage area. Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

Type of Contaminant:	Air Speed:
solvent, vapours, degreasing etc., evaporating from tank (in still air).	0.25- 0.5 m/s (50- 100 f/min.)
aerosols, fumes from pouring operations, intermittent container filling, low speed conveyer transfers, welding, spray drift, plating acid fumes, pickling (released at low velocity into zone of active generation)	0.5- 1 m/s (100- 200 f/min.)
direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion)	1- 2.5 m/s (200- 500 f/min.)
grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion).	2.5- 10 m/s (500- 2000 f/min.)

Within each range the appropriate value depends on:

continued...

Ardex WPM 256 - Part A

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 8 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

Lower end of the range

1: Room air currents minimal or favourable to capture

2: Contaminants of low toxicity or of nuisance value only.

3: Intermittent, low production.

4: Large hood or large air mass in motion

Upper end of the range

1: Disturbing room air currents

2: Contaminants of high toxicity

3: High production, heavy use

4: Small hood- local control only

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 1-2 m/s (200-400 f/min) for extraction of solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

APPEARANCE

Translucent green/yellow high viscosity liquid with a mild amine odour; emulsifies in water.

PHYSICAL PROPERTIES

Liquid.

State	Liquid	Molecular Weight	Not Applicable
Melting Range (°C)	Not Available	Viscosity	Not Available
Boiling Range (°C)	100	Solubility in water (g/L)	Partly Miscible
Flash Point (°C)	Not Available	pH (1% solution)	Not Available
Decomposition Temp (°C)	Not Available	pH (as supplied)	9.5- 10.5
Autoignition Temp (°C)	Not Available	Vapour Pressure (kPa)	Not Available
Upper Explosive Limit (%)	Not Available	Specific Gravity (water=1)	0.97- 0.99
Lower Explosive Limit (%)	Not Available	Relative Vapour Density (air=1)	Not Available
Volatile Component (%vol)	72 approx.	Evaporation Rate	Not Available

Section 10 - STABILITY AND REACTIVITY

CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

For incompatible materials - refer to Section 7 - Handling and Storage.

continued...

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet
Issue Date: 15-Oct-2010
NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17
Version No:3
CD 2010/1 Page 9 of 15

Section 11 - TOXICOLOGICAL INFORMATION

POTENTIAL HEALTH EFFECTS

ACUTE HEALTH EFFECTS

SWALLOWED

■ The material has NOT been classified by EC Directives or other classification systems as "harmful by ingestion". This is because of the lack of corroborating animal or human evidence. The material may still be damaging to the health of the individual, following ingestion, especially where pre-existing organ (eg. liver, kidney) damage is evident. Present definitions of harmful or toxic substances are generally based on doses producing mortality rather than those producing morbidity (disease, ill-health). Gastrointestinal tract discomfort may produce nausea and vomiting. In an occupational setting however, ingestion of insignificant quantities is not thought to be cause for concern.

EYE

■ This material can cause eye irritation and damage in some persons.

Vapours of volatile amines irritate the eyes, causing excessive secretion of tears, inflammation of the conjunctiva and slight swelling of the cornea, resulting in "halos" around lights. This effect is temporary, lasting only for a few hours. However this condition can reduce the efficiency of undertaking skilled tasks, such as driving a car. Direct eye contact with liquid volatile amines may produce eye damage, permanent for the lighter species.

The material may produce moderate eye irritation leading to inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis.

SKIN

■ This material can cause inflammation of the skin on contact in some persons.

The material may accentuate any pre-existing dermatitis condition.

Amine epoxy-curing agents (hardeners) may produce primary skin irritation and sensitisation dermatitis in predisposed individuals. Cutaneous reactions include erythema, intolerable itching and severe facial swelling. Blistering, with weeping of serous fluid, and crusting and scaling may also occur. Individuals exhibiting "amine dermatitis" may experience a dramatic reaction upon re-exposure to minute quantities. Highly sensitive persons may even react to cured resins containing trace amounts of unreacted amine hardener. Minute quantities of air-borne amine may precipitate intense dermatological symptoms in sensitive individuals. Prolonged or repeated exposure may produce tissue necrosis.

Volatile amine vapours produce irritation and inflammation of the skin. Direct contact can cause burns. They may be absorbed through the skin and cause similar effects to swallowing, leading to death. The skin may exhibit whiteness, redness and wheals.

Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects. Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.

The material may cause skin irritation after prolonged or repeated exposure and may produce on contact skin redness, swelling, the production of vesicles, scaling and thickening of the skin.

INHALED

■ Inhalation of vapours or aerosols (mists, fumes), generated by the material during the course of normal handling, may be damaging to the health of the individual.

The material can cause respiratory irritation in some persons. The body's response to such irritation can cause further lung damage.

Inhalation of amine vapours may cause irritation of the mucous membrane of the nose and throat, and lung irritation with respiratory distress and cough. Swelling and inflammation of the respiratory tract is seen in serious cases; with headache, nausea, faintness and anxiety. There may also be wheezing.

Inhalation of epoxy resin amine hardeners (including polyamines and amine adducts) may produce bronchospasm

continued...

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 10 of 15

Section 11 - TOXICOLOGICAL INFORMATION

and coughing episodes lasting several days after cessation of the exposure. Even faint traces of these vapours may trigger an intense reaction in individuals showing "amine asthma". The literature records several instances of systemic intoxications following the use of amines in epoxy resin systems.

CHRONIC HEALTH EFFECTS

■ There is some evidence that inhaling this product is more likely to cause a sensitisation reaction in some persons compared to the general population.

Skin contact with the material is more likely to cause a sensitisation reaction in some persons compared to the general population.

There is some evidence from animal testing that exposure to this material may result in toxic effects to the unborn baby.

Exposure to the material for prolonged periods may cause physical defects in the developing embryo (teratogenesis).

Sensitisation may give severe responses to very low levels of exposure, i.e. hypersensitivity. Sensitised persons should not be allowed to work in situations where exposure may occur.

Inhalation of epoxy resin amine hardeners (including polyamines and amine adducts) may produce bronchospasm and coughing episodes lasting several days after cessation of the exposure. Even faint traces of these vapours may trigger an intense reaction in individuals showing "amine asthma". The literature records several instances of systemic intoxications following the use of amines in epoxy resin systems.

TOXICITY AND IRRITATION

■ unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

ARDEX WPM 256 - PART A:

■ Not available. Refer to individual constituents.

POLYAMIDE RESIN:

TOXICITY

Oral (rat) LD50: 23100 mg/kg

IRRITATION

Skin (rabbit): Mild [Man HENK]

TRIETHYLENETETRAMINE:

TOXICITY

Oral (rat) LD50: 2500 mg/kg

Dermal (rabbit) LD50: 805 mg/kg

IRRITATION

Skin (rabbit): 490 mg Open SEVERE

Skin (rabbit): 5 mg/24 SEVERE

Eye (rabbit); 49 mg - SEVERE

Eye (rabbit):20 mg/24 h - Moderate

■ Contact allergies quickly manifest themselves as contact eczema, more rarely as urticaria or Quincke's oedema. The pathogenesis of contact eczema involves a cell-mediated (T lymphocytes) immune reaction of the delayed type. Other allergic skin reactions, e.g. contact urticaria, involve antibody-mediated immune reactions. The significance of the contact allergen is not simply determined by its sensitisation potential: the distribution of the substance and the opportunities for contact with it are equally important. A weakly sensitising substance which is widely distributed can be a more important allergen than one with stronger sensitising potential with which few individuals come into contact. From a clinical point of view, substances are noteworthy if they produce an allergic test reaction in more than 1% of the persons tested. Handling ethyleneamine products is complicated by their tendency to react with other chemicals, such as carbon dioxide in the air, which results in the formation of solid carbamates. Because of their ability to produce chemical burns, skin rashes, and asthma-like symptoms, ethyleneamines also require substantial care in handling. Higher molecular weight ethyleneamines are often handled at elevated temperatures further increasing the possibility of vapor exposure to these compounds. Because of the fragility of eye tissue, almost any eye contact with any ethyleneamine may cause irreparable damage, even blindness. A single, short exposure to ethyleneamines, may cause severe skin burns, while a single, prolonged exposure may result in the material being absorbed through the skin in harmful amounts. Exposures have caused allergic skin reactions in some individuals. Single dose oral toxicity of

continued...

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 11 of 15

Section 11 - TOXICOLOGICAL INFORMATION

ethyleneamines is low. The oral LD50 for rats is in the range of 1000 to 4500 mg/kg for the ethyleneamines.

In general, the low-molecular weight polyamines have been positive in the Ames assay, increase sister chromatid exchange in Chinese hamster ovary (CHO) cells, and are positive for unscheduled DNA synthesis although they are negative in the mouse micronucleus assay. It is believed that the positive results are based on its ability to chelate copper.

The material may produce severe irritation to the eye causing pronounced inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis.

The material may cause severe skin irritation after prolonged or repeated exposure and may produce on contact skin redness, swelling, the production of vesicles, scaling and thickening of the skin. Repeated exposures may produce severe ulceration.

For alkyl polyamines:

The alkyl polyamines cluster consists of a primary and a secondary amine groups and are derivatives of low molecular weight ethylenediamine, propylenediamine or hexanediamine. Toxicity depends on route of exposure. Cluster members have been shown to cause skin irritation or sensitization, eye irritation and genetic defect but do not cause cancer. They are known to potentiate NMDA induced whole-cell currents in cultured striatal neurons.

Asthma-like symptoms may continue for months or even years after exposure to the material ceases. This may be due to a non-allergenic condition known as reactive airways dysfunction syndrome (RADS) which can occur following exposure to high levels of highly irritating compound. Key criteria for the diagnosis of RADS include the absence of preceding respiratory disease, in a non-atopic individual, with abrupt onset of persistent asthma-like symptoms within minutes to hours of a documented exposure to the irritant. A reversible airflow pattern, on spirometry, with the presence of moderate to severe bronchial hyperreactivity on methacholine challenge testing and the lack of minimal lymphocytic inflammation, without eosinophilia, have also been included in the criteria for diagnosis of RADS. RADS (or asthma) following an irritating inhalation is an infrequent disorder with rates related to the concentration of and duration of exposure to the irritating substance. Industrial bronchitis, on the other hand, is a disorder that occurs as result of exposure due to high concentrations of irritating substance (often particulate in nature) and is completely reversible after exposure ceases. The disorder is characterised by dyspnea, cough and mucus production. Triethylenetetramine (TETA) is a severe irritant to skin and eyes and may induce skin sensitisation. Acute exposure to saturated vapour via inhalation was tolerated without impairment but exposure to aerosol may lead to reversible irritations of the mucous membranes in the respiratory tract. However, studies done on experimental animals showed that it does not cause cancer, foetal toxicity or developmental effect. Exposure to the material for prolonged periods may cause physical defects in the developing embryo (teratogenesis).

Section 12 - ECOLOGICAL INFORMATION

POLYAMIDE RESIN:

TRIETHYLENETETRAMINE:

■ Harmful to aquatic organisms, may cause long-term adverse effects in the aquatic environment.

Do NOT allow product to come in contact with surface waters or to intertidal areas below the mean high water mark. Do not contaminate water when cleaning equipment or disposing of equipment wash-waters.

Wastes resulting from use of the product must be disposed of on site or at approved waste sites.

For ethyleneamines:

Adsorption of the ethyleneamines correlates closely with both the cation exchange capacity (CEC) and organic content of the soil. Soils with increased CEC and organic content exhibited higher affinities for these amines. This dependence of adsorption on CEC and organic content is most likely due to the strong electrostatic interaction between the positively charged amine and the negatively charged soil surface.

For alkyl polyamines:

All members of this cluster are miscible or soluble in water. The estimated value of log K_{ow}s-range from 3.67

continued...

Ardex WPM 256 - Part A

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 12 of 15

Section 12 - ECOLOGICAL INFORMATION

to 1.8 is consistent with the available experimental water solubilities. Vapour pressures range from 1.1×10^{-6} hPa to 0.31 hPa. Estimated and experimental pKbs are in a relatively narrow range of 9.68 to 10.7.

Environmental fate:

Members of this cluster are expected to have varying degrees of mobility in the soil. Low vapor pressure and Henry's Law Constants suggest that these compounds are not expected to be in the vapor phase. Modeling suggests that all members of this cluster are likely to react rapidly with photochemically produced hydroxyl radicals with half-lives on the order of an hour, but with little material in the vapor phase, it is not expected to be a predominant removal pathway for these chemicals. Experimental data and results from estimation models indicate that all members of this cluster have the potential to biodegrade aerobically under environmental conditions. Fugacity models indicate that the members of this cluster are likely to partition predominately to soil and water. All chemicals in this cluster are expected to have low environmental persistence. Measured and estimated bioconcentration factors for members of this cluster indicate a low potential for bioaccumulation.

Ecotoxicity:

Evaluation of the available experimental and estimated aquatic toxicity data indicate acute toxicity to fish is low. Daphnia aquatic toxicity is generally low. Algae appear to be the most sensitive organism with several members of the cluster having measured or estimated toxicity values indicative of moderate toxicity. Chronic toxicity for all cluster members is estimated; it is generally low for fish and algae, but high for daphnia.

for triethylenetetramine (TETA):

Environmental fate:

TETA is completely miscible with water forming an alkaline solution (pH 10 at 10 g/l). The technical product has a vapour pressure of ca. 1 Pa at 20 C. The calculated Log Pow (unprotonated form) amounts to ca. -1.4 and indicates a low potential for bioaccumulation. There are no measured Koc -values available. For ethylenediamine (CAS Nr. 107- 15-3) and diethylenetriamine (CAS Nr. 111-40- 0), Koc -values of 4766 and 19111 were measured respectively. The high adsorption is most likely due to electrostatic interaction. A comparable Koc can be expected for TETA, which would suggest a high potential for geoaccumulation.

TETA is not readily biodegradable (0% after 20 days, OECD GL 301 D; same result with adapted inoculum). Also, in a test on inherent biodegradability with industrial sludge,

TETA was not degraded (0 % DOC removal after 28 days, OECD GL 302 B). TETA has therefore to be regarded as non-biodegradable. Adsorption onto sewage sludge was not observed. In a test on hydrolysis, TETA was not found to have undergone hydrolysis after 36 days.

Direct photolysis of TETA in the hydrosphere is not to be expected (molar extinction coefficient $< 10 \text{ l} / (\text{mol} \cdot \text{cm})$ at $> 240 \text{ nm}$). The half - life due to photooxidative degradation by OH-radicals in the atmosphere is estimated to be 1.7 hours. As TETA does have a low tendency to pass from water to air, this does not represent a significant removal process from the environment.

Based upon the physical-chemical and biodegradation properties of TETA, no elimination in waste water treatment plants is assumed.

Ecotoxicity:

Fish LC50 (96 h): *Poecilia reticulata* 570 mg/l

Other test results with *Leuciscus idus* and *Pimephales promelas*, which could not be validated, are in the same order of magnitude.

Daphnia magna EC50 (48 h): 31.1 - 33.9 mg/l (immobilisation several tests); (21 d) > 3.2 - < 10 mg/l; NOEC 1 mg/l (immobilisation of parental organisms was the most sensitive effect parameter).

Concentrations of 293 - 7313 mg/l had no teratogenic effects on sea-urchin (*Paracentrotus lividus*) eggs. The larvae were most sensitive and showed delay of development at 293 mg/l

Algal *Scenedesmus subspicatus* EBC50 (72 h) 2.5 mg/l; EBC10 0.67 mg/l; EuC50 ≥ 100 mg/l; EuC10 0.95 mg/l Effect: growth inhibition (B = biomass; u = growth rate)

Algal *Selenastrum capricornutum* EC50 (72 h) 20 mg/l Effect: growth inhibition (biomass) ; NOEC < 2.5 mg/l; EC50 (96 h) 3,7 mg/l

Microorganisms *Pseudomonas fluorescens* EC0 (24 h): 500 mg/l Effect: growth inhibition (biomass)

Bird acute LD50 (18 h): redwinged blackberry > 101 mg/kg.

Prevent, by any means available, spillage from entering drains or water courses.

DO NOT discharge into sewer or waterways.

continued...

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 13 of 15

Section 12 - ECOLOGICAL INFORMATION

Ecotoxicity

Ingredient	Persistence: Water/Soil	Persistence: Air	Bioaccumulation	Mobility
triethylenetetramine	LOW		LOW	MED

Section 13 - DISPOSAL CONSIDERATIONS

- Containers may still present a chemical hazard/ danger when empty.
 - Return to supplier for reuse/ recycling if possible.
- Otherwise:
- If container can not be cleaned sufficiently well to ensure that residuals do not remain or if the container cannot be used to store the same product, then puncture containers, to prevent re-use, and bury at an authorised landfill.
 - Where possible retain label warnings and MSDS and observe all notices pertaining to the product.

Section 14 - TRANSPORTATION INFORMATION

HAZCHEM:

None (ADG7)

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS: UN, IATA, IMDG

Section 15 - REGULATORY INFORMATION

POISONS SCHEDULE S5

REGULATIONS

Regulations for ingredients

triethylenetetramine (CAS: 112-24-3) is found on the following regulatory lists;

"Australia Hazardous Substances", "Australia Inventory of Chemical Substances (AICS)", "GESAMP/EHS Composite List - GESAMP Hazard Profiles", "IMO IBC Code Chapter 17: Summary of minimum requirements", "IMO MARPOL 73/78 (Annex II) - List of Noxious Liquid Substances Carried in Bulk", "IMO Provisional Categorization of Liquid Substances - List 3: (Trade-named) mixtures containing at least 99% by weight of components already assessed by IMO, presenting safety hazards", "OECD Representative List of High Production Volume (HPV) Chemicals"

No data for Ardex WPM 256 - Part A (CW: 8044-17)

No data for polyamide resin (CAS: , Not avail)

Section 16 - OTHER INFORMATION

REPRODUCTIVE HEALTH GUIDELINES

■ Established occupational exposure limits frequently do not take into consideration reproductive end points that are clearly below the thresholds for other toxic effects. Occupational reproductive guidelines (ORGs)

continued...

Ardex WPM 256 - Part A

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 14 of 15

Section 16 - OTHER INFORMATION

have been suggested as an additional standard. These have been established after a literature search for reproductive no-observed-adverse effect-level (NOAEL) and the lowest-observed-adverse-effect-level (LOAEL). In addition the US EPA's procedures for risk assessment for hazard identification and dose-response assessment as applied by NIOSH were used in the creation of such limits. Uncertainty factors (UFs) have also been incorporated.

Ingredient	ORG	UF	Endpoint	CR	Adeq TLV
triethylenetetramine	2.9 mg/m ³	10	D	NA	-

■ These exposure guidelines have been derived from a screening level of risk assessment and should not be construed as unequivocally safe limits. ORGS represent an 8-hour time-weighted average unless specified otherwise.

CR = Cancer Risk/10000; UF = Uncertainty factor:

TLV believed to be adequate to protect reproductive health:

LOD: Limit of detection

Toxic endpoints have also been identified as:

D = Developmental; R = Reproductive; TC = Transplacental carcinogen

Jankovic J., Drake F.: A Screening Method for Occupational Reproductive

American Industrial Hygiene Association Journal 57: 641-649 (1996).

EXPOSURE STANDARD FOR MIXTURES

■ "Worst Case" computer-aided prediction of vapour components/concentrations:

■ Composite Exposure Standard for Mixture (TWA) (mg/m³): 6 mg/m³

■ If the breathing zone concentration of ANY of the components listed below is exceeded, "Worst Case" considerations deem the individual to be overexposed.

Component	Breathing Zone ppm	Breathing Zone mg/m ³	Mixture Conc: (%)
-----------	--------------------	----------------------------------	-------------------

Component	Breathing zone (ppm)	Breathing zone (mg/m ³)	Mixture Conc (%)
triethylenetetramine	1.00	6.0000	2.0
triethylenetetramine	0.00	0.0000	0.0

■ Operations which produce a spray/mist or fume/dust, introduce particulates to the breathing zone.

If the breathing zone concentration of ANY of the components listed below is exceeded, "Worst Case" considerations deem the individual to be overexposed.

■ At the "Composite Exposure Standard for Mixture" (TWA) (mg/m³): 6 mg/m³

■ Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:

www.chemwatch.net/references.

■ The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

Issue Date: 15-Oct-2010

continued...

Ardex WPM 256 - Part A

Chemwatch Material Safety Data Sheet

Issue Date: 15-Oct-2010

NC317TCP

Hazard Alert Code: HIGH

CHEMWATCH 8044-17

Version No:3

CD 2010/1 Page 15 of 15

Section 16 - OTHER INFORMATION

Print Date: 3-Feb-2011

This is the end of the MSDS.